

BUNN®

MODEL JDF-4S Circuit Board Grounding Kit #42019.0000

Kit Contents:

42012.0000	Harness
00973.0000	Nut, Keps #6-32
42031.0000	Instructions

Introduction:

This kit is to be used on all 37300.xxxx model machines. It can also be used on 37900.xxxx model machines that have a 40177.xxxx circuit board installed.

WARNING- Disconnect power from the machine prior to removal of any panels for service.

Installation:

1. Remove drip tray and splash panel on front of machine.
2. Remove left side panel for easier access to ground connection.
3. Locate connector J5 on circuit board (Figure 1) and disconnect the harness from this connector.
4. Connect the male end of the adaptor harness provided with this kit to connection J5 on circuit board.
5. Reconnect the main harness connection to the female end of the adaptor harness.
6. Locate green wire with ring terminal off of the adaptor harness.
7. Attach ring terminal to the chassis ground stud located on the lower portion of the electronics panel. Install and tighten nut provided in this kit over the ring terminal and secure.
8. Reinstall splash panel and drip tray.
9. Reconnect to power source.
10. Installation complete.

Note – Do not install this adaptor harness kit to any machines that have the circuit board number 38587.0000. Refer to figure 2 below.

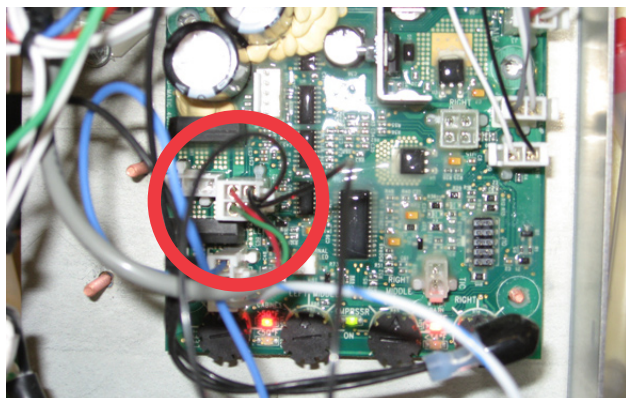


FIG. 1

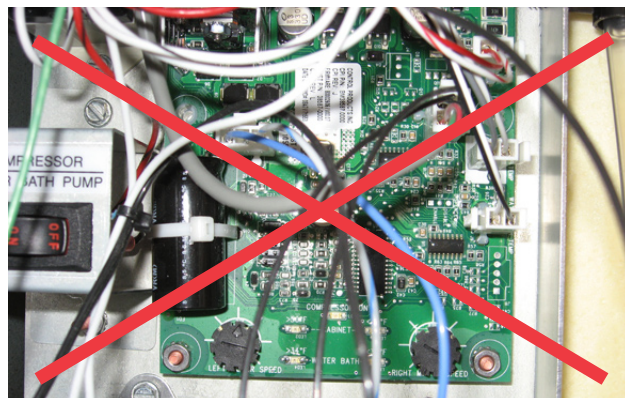


FIG. 2

BUNN-O-MATIC CORPORATION

POST OFFICE BOX 3227

SPRINGFIELD, ILLINOIS 62708-3227

PHONE: (217) 529-6601 FAX: (217) 529-6644

