



JDF-2S & 4S Control Board Replacement Instructions #39422.1000

INTRODUCTION:

The control board for the JDF-4S (BUNN P/N: 39422.1000) can be used to replace the control board in the JDF-2S (BUNN P/N: 38587.1000). This can be accomplished by completing the following instructions.

KIT CONTENTS:

39422.1000	Control Board
40511.0000	Instructions

INSTRUCTIONS:

Step 1: Remove the drip tray and set aside.

Step 2: Remove the splash panel and set aside.

Step 3: Locate the control board and disconnect the seven connectors. (Eleven connectors on JDF-4S)


Step 4: Remove the four, star nuts that are securing the existing control board in place. Set the star nuts aside for later use. Remove the control board from the machine.

Step 5: Remove the two white nylon spacers from the old board and insert them onto the new replacement board.

Step 6: Place the replacement board into the machine and secure in place with the four, star nuts that you set aside earlier.

Step 7: Reconnect all connectors to the replacement board (seven for JDF-2S and eleven for JDF-4S). Use the image to insure all the wires are connected to the correct location. If this is not done correctly the machine will not operate properly.

*Note: When using the JDF-4S control board in a JDF-2S machine the middle right and right knobs are not used.

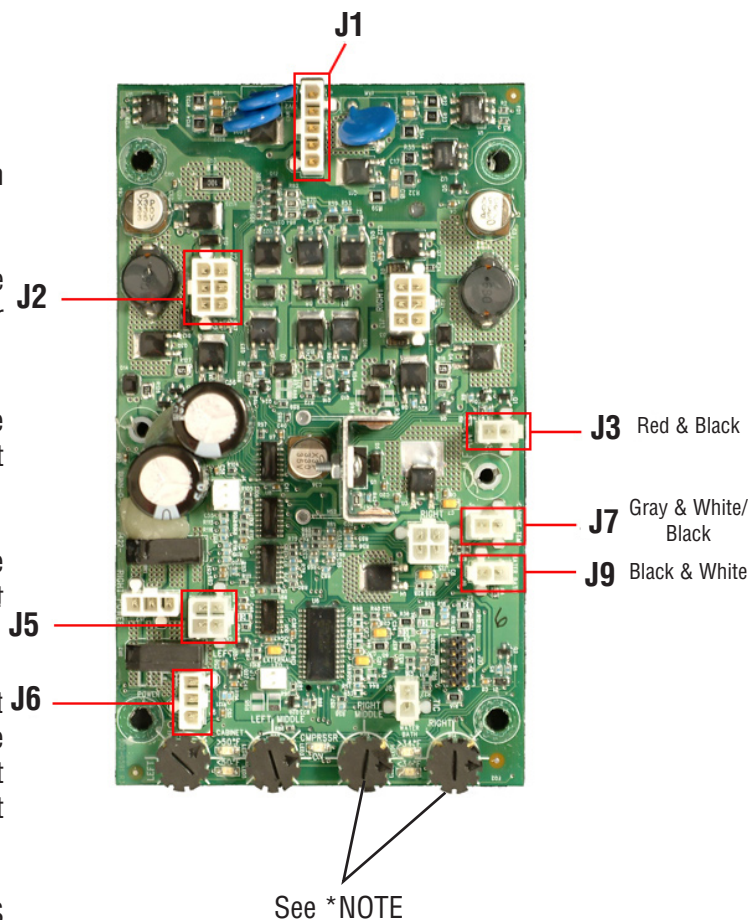

BUNN-O-MATIC CORPORATION

POST OFFICE BOX 3227

SPRINGFIELD, ILLINOIS 62708-3227

PHONE: (217) 529-6601 FAX: (217) 529-6644